

# Table of Contents

Version 1.4.2 (V1.4.2_241025) .....	1
Release .....	1
New Features and Improvements .....	1
Bug Fixes .....	1

# Version 1.4.2 (V1.4.2\_241025)

## Release

2024-10-28

Devices with the new BLE chip cannot downgrade to a lower version after upgrading the firmware to v1.3.1 or higher.

Devices with existing BLE chips can be downgraded to a lower version.

For more information, check the serial number of the device and contact the Suprema (<https://supremainc.com>).

## New Features and Improvements

1. Supports for device firmware upgrade via the Device Manager application.
2. Added feature to set the baud rate of slave devices.
3. Improved to get user update succeeded event log using the GetLogWithFilter function in the SDK.
4. Improved RS-485 communication quality.

## Bug Fixes

1. Deleted image logs from the device gets continuously uploaded to the server. (Affects version: v1.3.1)
2. When running the Device Manager application v1.1.8 on certain iOS, the device does not connect. (Affects version: v1.0.0)
3. When the **Input card ID from keypad** option is enabled, there is an issue where the card ID value recorded in the event log differs from the entered value when an unassigned card ID is input using the keypad. (Affects version: v1.0.0)
4. When a user with a 32-character user ID authenticates to the device while the device is not connected to the server, the authentication event log is not updated in BioStar 2 even after the device is reconnected to the server. (Affects version: v1.0.0)
5. The user ID stored as a 32-character string is truncated to only 31 characters in a specific event log. (Affects version: v1.0.0)
6. After a firmware upgrade, authentication failure occurs with the previously used cards. (Affects version: v1.4.1)
7. When the **Time Synchronization with Server** option is disabled and the device time is changed, the device restarts abnormally. (Affects version: v1.4.1)

8. When the **RS-485** mode is set to **Slave**, the **Custom Smart Card Layout** and **Byte Order** of the device are not saved as set. (Affects version: v1.4.1)
9. When the device is restarted with the **Primary Key** set only in the **Suprema Smart Card Layout** and the **Secondary Key** set only in the **Custom Smart Card Layout**, the device recognizes the Custom Smart Card as a CSN card. (Affects version: v1.4.1)
10. Some smart cards fail to be recognized in environments using the new SE chip firmware. (Affects version: v1.4.1)
11. DESFire smart cards with the **Custom Smart Card Layout** set to **Secondary Key** are recognized as CSN cards. (Affects version: v1.4.1)
12. Custom smart cards with the **DESFire Advanced** option enabled fail to be recognized. (Affects version: v1.4.1)

From:

<http://kb.supremainc.com/knowledge/> -

Permanent link:

[http://kb.supremainc.com/knowledge/doku.php?id=en:xp2\\_revision\\_note\\_142&rev=1731549365](http://kb.supremainc.com/knowledge/doku.php?id=en:xp2_revision_note_142&rev=1731549365)

Last update: **2024/11/14 10:56**