1.3.0 (V1.3.0_190805)	1
	1
	1
Main Fixes	1
Bug Fixes	2

2024/12/15 09:55 1/2 1.3.0 (V1.3.0_190805)

1.3.0 (**V1.3.0_190805**)

2019-09-25

1. OSDP OSDP V2.1.7 2. 가 가 3. APB 4. 5. 2048 6. 가 7. 가 가 8. 9.Wiegand ID ID 10. (가) 11. OSDP

- 12. Improves the Enhanced fake face enrollment block.
- 13. Improves the usability.
- Expanded the area of the menu button.
- 14. Support for RS-485 connections to new devices
- XPass 2(XP2-MDPB, XP2-GDPB, XP2-GKDPB)

Main Fixes

2024/12/15 09:55 2/2 1.3.0 (V1.3.0 190805)

1. The master device abnormally shuts down if it is operated after reconnecting a disconnected slave device.

- 2. The master device reboots abnormally when a user authenticates the face to the slave device continuously.
- 3. The master device abnormally shuts down if the RS-485 mode of the master device is changed after disconnecting the 31 connected slave devices.

Bug Fixes

- 1. When upgrading firmware using USB, upgrade failed due to a timeout.
- Changed the timeout from 90 seconds to 5 minutes.
- 2. Scanning a deleted card to the device caused the device to restart abnormally.
- 3. The device recognized the iCLASS Seos card as a CSN card.
- 4. Importing user data exported from BioStation A2 caused the device to restart abnormally.
- 5. Start time was not applied in UTC when importing filtered logs using SDK.
- 6. Relay worked after reconnecting for authentication that occurred when elevator connection was disconnected.
- 7. Access was denied and user ID was displayed abnormally when using a smart card or fingerprint authentication in One Device Mode.
- 8. The Wiegand output data were transmitted in duplicate.
- 9. A delay occurred in opening the door when authentication succeeds, and the device UI was generally slow to respond.

From:

http://kb.supremainc.com/knowledge/ -

Permanent link:

http://kb.supremainc.com/knowledge/doku.php?id=ko:fs2 revision note 130&rev=1620785985

Last update: **2021/05/12 11:19**