

# Table of Contents

Version 1.2.0 (V1.2.0_181129) .....	1
Release .....	1
New Features and Improvements .....	1
Main Fixes .....	1
Bug Fixes .....	1

# Version 1.2.0 (V1.2.0\_181129)

## Release

2018-11-29

## New Features and Improvements

1. Support to the number of users, fingerprints, faces, and cards in Manage Users in Device.
2. Change the maximum value of the interval and width for the Wiegand Input.
3. Improves the data protection.
  - Increase the items to encrypt the data.
  - Support to setting the period for storing the personal information.
4. If the data transmission fails when communicating with OSDP, it is transmitted again.
5. The site key is initialized if a secure tamper event occurs
6. If an administrator has registered, modified, or deleted a user, the event log shows whether the editing was done on the server or on the device.
7. Support to the creation of up to 2048 Access Levels and Access Groups.
8. Support to AES encryption type for DESFire card.
9. Support to DESFire/DESFire EV1 Advanced option.
10. When using The bypass, The card ID is output as Wiegand even though a user authenticates with the AoC.

## Main Fixes

1. When using iCLASS Seos card, the card does not work as set even though the key setting is changed.
2. A code is added to prevent the authentication fails because the cache memory is broken.

## Bug Fixes

1. If the user uses the BS\_GetLogBlob command to get the door ID, the door ID is not output normally.
2. When communicating with OSDP, the LED color is displayed differently from the setting.
3. The device cannot read CSN because the card recognized as an NFC tag.

4. Modified the firmware of that slave device so that it cannot be upgraded when a device not supported by the master device is connected as a slave.
5. If the elevator is configured by connecting the OM-120 to the device, the relays operate differently from the previous status when the slave device is rebooted.
6. The alarm can be released in the Floors status after a fire alarm occurs when the elevator is configured as a Fire Alarm Zone.

From:

<http://kb.supremainc.com/knowledge/> -

Permanent link:

[http://kb.supremainc.com/knowledge/doku.php?id=en:bep2\\_revision\\_note\\_120&rev=1622504846](http://kb.supremainc.com/knowledge/doku.php?id=en:bep2_revision_note_120&rev=1622504846)

Last update: **2021/06/01 08:47**