

Table of Contents

Version 1.0.2 (V1.0.2_230111)	1
Release	1
New features and improvement	1
Bug Fixes	1

Version 1.0.2 (V1.0.2_230111)

Release

2023-01-20

New features and improvement

1. Supports a new SE processor and new firmware.
 - Support downgrade to lower version firmware.
2. Fixed incorrect **Partial Modify Fail (Server)** log occurred by changing user information from the server where the user does not exist on the device.

Bug Fixes

1. When using the relay of the master device for the door, the door does not open when authenticating from the device connected as a slave. (Affects version: v1.0.0)
2. Face authentication does not work when set to low **Baud Rate** in **Serial Setting**. (Affects version: v1.0.0)
3. Missing custom font files other than English and Korean. (Affects version: v1.0.0)
4. When authenticating with face, the Wiegand port outputs an incorrect value as other user information that was previously authenticated with card. (Affects version: v1.0.0)
5. Door Locked event occurs when input signal gets detected while configured to Arm/Disarm by input signal. (Affects version: v1.0.0)
6. Modifying the authentication mode causes other previously set authentication modes to disappear. (Affects version: v1.0.0)
7. The list number column and list column overlaps on the extension number screen. (Affects version: v1.0.0)
8. When issuing a smartcard including a visual face template using the SDK, the card scan screen suddenly disappears. (Affects version: v1.0.0)

From:

<https://kb.supremainc.com/knowledge/> -

Permanent link:

https://kb.supremainc.com/knowledge./doku.php?id=en:bs3_revision_note_102&rev=1674778164

Last update: **2023/01/27 09:09**