

Table of Contents

| | |
|-------------------------------------|---|
| Version 1.9.0 (V1.9.0_210618) | 1 |
| Release | 1 |
| New Features and Improvements | 1 |
| Bug fixes | 1 |

Version 1.9.0 (V1.9.0_210618)

Release

2021-06-25

New Features and Improvements

1. Improved manually turning the secure tamper on or off even when the default hash key is set.
2. Separated event logs of Mobile Access cards and RFID cards.

Bug fixes

1. The RS-485 communication did not work properly when connecting the device to a third-party controller via OSDP after activating the Secure Communication mode. (Affects version: v1.8.0 or earlier)
2. The screen was abnormally displayed when the second user authentication was successful on a slave device with dual authentication. (Affects version: v1.9.0 or earlier)
3. The firmware upgrade failed when the device was connected as a slave device. (Affects version: v1.8.0 or earlier)
4. It was not able to recognize Mobile Access Card after upgrading the firmware. (BSA2-OIPW, BSA2-OMPW / Affects version: v1.9.0 or earlier)
5. DNS queries were sent to an IP address that was not set. (Affects version: v1.8.0 or earlier)
6. The changed settings were reflected in the log but were not displayed properly on the screen when the time and attendance code settings were changed. (Affects version: v1.8.0 or earlier)
7. The relay operated as Off (Lock) after setting the scheduled unlock zone in the elevator and rebooting the master device. (Affects version: v1.8.0 or earlier)
8. All files in the database were deleted after exporting them to a USB. (Affects version: v1.8.0 or earlier)
9. The slave device rebooted abnormally. (Affects version: v1.8.0 or earlier)
10. Disconnected logs frequently occurred when the device was used with Secure I/O 2. (Affects version: v1.8.0 or earlier)

11. The Wiegand reader operated as Unlock after setting the Wiegand reader connected to DM-20 to Lock and rebooting the device when using the device with DM-20. (Affects version: v1.8.0 or earlier)
12. The door remained locked and did not open after rebooting the device when it was set to Manual Unlock. (Affects version: v1.8.0 or earlier)
13. Ten administrators were still not deleted from the device when initializing the device that has 1,000 assigned administrators. (Affects version: v1.8.0 or earlier)
14. When enrolling a new fingerprint to AoC, it was able to authenticate the user with both the new fingerprint data and the existing fingerprint data. (Affects version: v1.8.0 or earlier)
15. When the slave device in Fire Alarm Zone triggered an alarm, the alarm did not sound if the master device was rebooted. (Affects version: v1.8.0 or earlier)
16. The door relay status was not displayed properly when rebooting the master device while Manual Lock or Manual Unlock was set. (Affects version: v1.8.0 or earlier)

From:

<https://kb.supremainc.com/knowledge/> -

Permanent link:

https://kb.supremainc.com/knowledge/doku.php?id=en:bsa2_revision_note_190

Last update: **2021/07/12 10:12**