

Table of Contents

Version 1.3.0 (V1.3.0_210621)	1
Release	1
New Features and Improvements	1
Bug fixes	1

Version 1.3.0 (V1.3.0_210621)

Release

2021-07-07

New Features and Improvements

1. Improved manually turning the secure tamper on or off even when the default hash key is set.
2. Upgraded to the 1.1.1i version of OpenSSL.
3. Separated event logs of Mobile Access cards and RFID cards.

Bug fixes

1. The RS-485 communication did not work properly when connecting the device to a third-party controller after activating the Secure Communication mode. (Affects version: v1.2.0 or earlier)
2. The screen was abnormally displayed when the second user authentication was successful on a slave device with dual authentication. (Affects version: v1.2.0 or earlier)
3. After being disconnected from BioStar 2, an incorrect pop-up message was displayed until they were reconnected. (Affects version: v1.2.0 or earlier)
4. The device rebooted abnormally when the firmware version was upgraded to 1.2.0 after changing the slave device with firmware version 1.1.0 to a master device. (Affects version: v1.2.0 or earlier)
5. The relay operated as Off (Lock) after setting the scheduled unlock zone in the elevator and rebooting the master device. (Affects version: v1.2.0 or earlier)
6. All files in the database were deleted after exporting them to a USB. (Affects version: v1.2.0 or earlier)
7. The slave device rebooted abnormally. (Affects version: v1.2.0 or earlier)
8. The RS-485 disconnection log continuously occurred when Secure I/O 2 was connected. (Affects version: v1.2.0 or earlier)
9. The Wiegand reader operated as Unlock after setting the Wiegand reader connected to DM-20 to Lock and rebooting the device when using the device with DM-20. (Affects version: v1.2.0 or earlier)
10. The door remained locked and did not open after rebooting the device when it was set to Manual Unlock. (Affects version: v1.2.0 or earlier)
11. Ten administrators were still not deleted from the device when initializing the device that has 1,000 assigned administrators. (Affects version: v1.2.0 or earlier)
12. An improper error message was displayed when a user who only registered a card scanned the card after setting the authentication mode to Card + Face / PIN on the device. (Affects version: v1.2.0 or earlier)
13. When enrolling a new fingerprint to AoC, it was able to authenticate the user with both the new fingerprint data and the existing fingerprint data. (Affects version: v1.2.0 or earlier)

From:

<https://kb.supremainc.com/knowledge/> -

Permanent link:

https://kb.supremainc.com/knowledge/doku.php?id=en:fl_revision_note_130

Last update: **2021/07/19 11:08**