

Table of Contents

Version 1.5.0 (V1.5.0_210628)	1
Release	1
New Features and Improvements	1
Main Fixes	1
Bug Fixes	1

Version 1.5.0 (V1.5.0_210628)

Release

2021-07-08

New Features and Improvements

1. Occupancy limit zone support
2. Added support for the option to toggle Screen Saver for slave devices.
3. Improved manually turning the secure tamper on or off even when the default hash key is set.
4. Separated event logs of Mobile Access cards and RFID cards.
5. Improved that the thermal camera works first when both the thermal camera and Wiegand bypass are set.
6. Changed to a new touch pad.

For devices with firmware version 1.4.2 or earlier, please follow the instructions below when replacing the front cover (touch pad).

- Replace the front cover after upgrading the firmware to version 1.5.0 or later.
- If you have already replaced the front cover before upgrading the firmware to version 1.5.0 or later, please upgrade to the latest version firmware again.

Main Fixes

1. Incorrect temperature was displayed when authenticating from a slave device with the thermal camera. (Affects version: v1.4.0, v1.4.1, v1.4.2)

Bug Fixes

1. The RS-485 communication did not work properly when connecting the device to a third-party controller after activating the Secure Communication mode. (Affects version: v1.4.2 or earlier)
2. A large number of 'Door closed' logs occurred abnormally when the door sensor was set to the input port of Secure I/O 2 connected as a slave device.
3. Added defensive code to initialize if an error in the IR LED value occurs. (Affects version: v1.3.0 or earlier)
4. The screen was abnormally displayed when the second user authentication was successful on a slave device with dual authentication. (Affects version: v1.4.2 or earlier)

5. An abnormal event log occurred when the temperature measurement failed after setting the temperature mode to 'Temperature Check Before Authentication'. (Affects version: v1.4.0, v1.4.1, v1.4.2)
6. An abnormal event log occurred when measuring temperature after setting the temperature mode to 'Check Temperature Only'. (Affects version: v1.4.0, v1.4.1, v1.4.2)
7. The changed settings were reflected in the log but were not displayed properly on the screen when the time and attendance code settings were changed. (Affects version: v1.4.2 or earlier)
8. The relay operated as Off (Lock) after setting the scheduled unlock zone in the elevator and rebooting the master device. (Affects version: v1.4.2 or earlier)
9. The performed action, such as temperature output, was different from the intended action responding to the input signal set in the Trigger & Action feature when using the Suprema Thermal Camera. (Affects version: v1.4.0, v1.4.1, v1.4.2)
10. An issue of Suprema Thermal Camera screen being maintained even when the thermal imaging camera was toggled from 'Enabled' to 'Disabled'. (Affects version: v1.4.0, v1.4.1, v1.4.2)
11. The device abnormally terminated when establishing a communication connection with 'Device→Server'. (Affects version: v1.4.2 or earlier)
12. All files in the database were deleted after exporting them to a USB. (Affects version: v1.4.2 or earlier)
13. The slave device rebooted abnormally. (Affects version: v1.4.2 or earlier)
14. The RS-485 disconnection log continuously occurred when Secure I/O 2 was connected. (Affects version: v1.4.2 or earlier)
15. Ten administrators were still not deleted from the device when initializing the device that has 1,000 assigned administrators. (Affects version: v1.4.2 or earlier)
16. Device registration using Mobile Access app does not work on dynamic sites. (Affects version: v1.4.2 or earlier)
17. The Wiegand reader operated as Unlock after setting the Wiegand reader connected to DM-20 to Lock and rebooting the device when using the device with DM-20. (Affects version: v1.4.2 or earlier)
18. When enrolling a new fingerprint to AoC, it was able to authenticate the user with both the new fingerprint data and the existing fingerprint data. (Affects version: v1.4.2 or earlier)
19. The door relay status was not displayed properly when rebooting the master device while Manual Lock or Manual Unlock was set. (Affects version: v1.4.2 or earlier)

From:

<https://kb.supremainc.com/knowledge/> -

Permanent link:

https://kb.supremainc.com/knowledge/doku.php?id=en:fs2_revision_note_150

Last update: **2021/11/09 13:42**