

Table of Contents

Version 1.5.2 (V1.5.2_220614)	1
Release	1
New Features and Improvements	1
Bug Fixes	1

Version 1.5.2 (V1.5.2_220614)

Release

2022-06-16

New Features and Improvements

1. Improved to check for the duplication of cards registered with users when transmitting user data from the server to devices.

Bug Fixes

1. The 'Delete the Root Certificate' was not displayed when a user with the administrator level accessed the menu on the device where the certificate was stored (Affects version: v1.1.1).
2. Abnormal continuous authentication occurs when using the thermal camera (Affects version: v1.4.0).
3. When initializing the master device with the 'Keep Network Settings' option, the RS-485 communication key was initialized and the slave device was disconnected (Affects version: v1.0.0).
4. When loading the logs for the user who entered the admin menu using the SDK, the user ID was not displayed (Affects version: v1.0.0).
5. 'Device → Server' connection did not work intermittently (Affects version: v1.4.0).
6. If some ports of the OM-120 connected as a slave are set as a door relay and the device is rebooted, the relay was operated abnormally (Affects version: v1.0.0).
7. The device rebooted abnormally when a user scanned a card on the device with several cards overlapped in a wallet or the like (Affects version: v1.0.0).
8. The user did not touch the device's touchscreen, but an abnormal touch behavior occurred on the device (Affects version: v1.5.0).
9. If the user authenticated on the device at the time of Auth Timeout, it was authenticated, but the door was not opened (Affects version: v1.4.0).
10. Unable to edit Subnet Mask value on device (Affects version: v1.4.0).
11. PIN authentication did not work properly when using Device Hashkey Management (Affects version: v1.4.0).
12. The user ID was abnormally displayed in the event log if the user authenticated with AoC set as the blacklist card when the User ID Type was set to Alphanumeric (Affects version: v1.0.0).
13. When authenticating on a device that has dual authentication set up, the authentication success sound is not output for the dual authentication result, and the home screen is maintained (Affects version: v1.5.0).
14. When authenticating on a device that has dual authentication set up, if the second user failed to

authenticate, the failure message was displayed twice (Affects version: v1.5.1).

15. When viewing the event log, the date selection pop-up window did not disappear even after the Menu Timeout (Affects version: v1.0.0).

16. When setting the elevator to the scheduled unlock zone and using the 'Started by User Authentication' option, the floor is activated normally when a user belonging to the access group authenticates, but the 'Floor released' logs are output (Affects version: v1.0.0).

17. When the LAN cable was removed and reconnected, it took a long time to receive the DHCP IP assignment (Affects version: v1.0.0).

18. False Acceptance (FA) occurred continuously (Affects version: v1.5.0).

From:

<http://kb.supremainc.com/knowledge/> -

Permanent link:

http://kb.supremainc.com/knowledge/doku.php?id=en:fs2_revision_note_152

Last update: **2022/08/24 14:00**