

Table of Contents

Version 1.1.2 (V1.1.2_211220)	1
Release	1
New features and improvement	1
Bug Fixes	1

Version 1.1.2 (V1.1.2_211220)

Release

2021-12-22

New features and improvement

1. Improved QR/Barcode reading performance.
2. Improved the speed at which the device recognizes objects.
3. Supports LCDs from multiple manufactures.

Bug Fixes

1. The device rebooted abnormally when a user scanned a card on the device with several cards overlapped in a wallet or the like (Affects version: v1.0.0).
2. When setting the elevator to the scheduled unlock zone and using the 'Started by User Authentication' option, the floor is activated normally when a user belonging to the access group authenticates, but the 'Floor released' logs are output (Affects version: v1.0.0).
3. Improved to check for the duplication of cards registered with users when transmitting user data from the server to devices (Affects version: v1.0.0).
4. The master device reboots if re-searching the slave device while RS-485 communication is operating normally (Affects version: v1.0.0).
5. String resources were not updated when upgrading firmware (Affects version: v1.0.0).
6. PIN authentication did not work properly when using Device Hashkey Management (Affects version: v1.0.0).
7. When loading the logs for the user who entered the admin menu using the SDK, the user ID was not displayed (Affects version: v1.0.0).
8. The device failed to recognize the iCLASS Seos card suddenly (XS2-APB, XS2-QAPB, XS2-OAPB) (Affects version: v1.0.0).
9. When authenticating on a device that has dual authentication set up, the authentication success sound is not output for the dual authentication result, and the home screen is maintained (Affects version: v1.0.0).

10. Slave devices are disconnected when the master device is rebooted (Affects version: v1.0.0).
11. Even though the device's language was set to Korean, some phrases were displayed on the screen in English (Affects version: v1.0.0).
12. The device reboots abnormally when the user authenticates the card continuously (Affects version: v1.0.0).
13. The 'Delete the Root Certificate' was not displayed when a user with the administrator level accessed the menu on the device where the certificate was stored (Affects version: v1.0.0).
14. When initializing the master device with the 'Without Network' option, the RS-485 communication key was initialized and the slave device was disconnected (Affects version: v1.0.0).

From:

<http://kb.supremainc.com/knowledge/> -

Permanent link:

http://kb.supremainc.com/knowledge/doku.php?id=en:xs2_revision_note_112&rev=1643330761

Last update: **2022/01/28 09:46**