

콘텐츠 테이블

버전 1.3.0 (V1.3.0_190805)	1
날짜	1
신규 기능 및 개선	1
Main Fixes	1
Bug Fixes	2

버전 1.3.0 (V1.3.0_190805)

날짜

2019-09-25

신규 기능 및 개선

1. OSDP 표준화

- 타사 컨트롤러와 연결할 때 OSDP V2.1.7 프로토콜을 준수하도록 개선

2. 추가 가능한 관리자 수 확대

3. 사용자별 APB 해제 지원

4. 카드 형식별 선택 옵션 지원

5. 최대 층 등급 수 2048개로 확대

6. 이미지 로그 설정에서 지원하는 이벤트 종류 추가

7. 장치 일괄 편집을 이용해 관리자를 추가할 때 새로운 설정이 적용되는 방식 변경

- 기존: 기존 설정에 새로 설정한 내용을 덮어쓰는 방식
- 변경: 기존 설정에 새로 설정한 내용을 추가하는 방식

8. 중복 얼굴 검사 지원

9. Wiegand 인증 결과값 출력 옵션을 선택할 수 있도록 지원

- User ID and Card ID

10. Supports Anti-Tailgating at doors.

11. If the data transmission fails when communicating with OSDP, it is transmitted again.

12. Improves the Enhanced fake face enrollment block.

13. Improves the usability.

- Expanded the area of the menu button.

14. Support for RS-485 connections to new devices

- XPass 2(XP2-MDPB, XP2-GDPB, XP2-GKDPB)

Main Fixes

1. The master device abnormally shuts down if it is operated after reconnecting a disconnected slave device.
2. The master device reboots abnormally when a user authenticates the face to the slave device continuously.
3. The master device abnormally shuts down if the RS-485 mode of the master device is changed after disconnecting the 31 connected slave devices.

Bug Fixes

1. When upgrading firmware using USB, upgrade failed due to a timeout.
 - Changed the timeout from 90 seconds to 5 minutes.
2. Scanning a deleted card to the device caused the device to restart abnormally.
3. The device recognized the iCLASS Seos card as a CSN card.
4. Importing user data exported from BioStation A2 caused the device to restart abnormally.
5. Start time was not applied in UTC when importing filtered logs using SDK.
6. Relay worked after reconnecting for authentication that occurred when elevator connection was disconnected.
7. Access was denied and user ID was displayed abnormally when using a smart card or fingerprint authentication in One Device Mode.
8. The Wiegand output data were transmitted in duplicate.
9. A delay occurred in opening the door when authentication succeeds, and the device UI was generally slow to respond.

From:
<http://kb.supremainc.com/knowledge/> -

Permanent link:
http://kb.supremainc.com/knowledge/doku.php?id=ko:fs2_revision_note_130&rev=1620785908

Last update: **2021/05/12 11:18**